Waters™

Application Note

Monitoring System Performance With System Suitability and Control Charts in Empower

Haining Pee

Waters Corporation

Este é um Resumo de aplicações e, por isso, não inclui uma seção de experimento detalhada.

Abstract

System Suitability is a series of injections you can make to help you determine the suitability and effectiveness of your chromatographic system before use. System Suitability requirements must pass to guarantee the quality of the sample run results. System Suitability injections also enable you to monitor method performance over time.

Introduction

Empower™ Chromatographic Data System (CDS) can assess System Suitability standards interactively, checking the performance of standards against your System Suitability requirements in an automated, unattended manner. Upon failing the requirements, Empower CDS can be configured to continue the sample run, abort the sample run, or reinject the standards. Subsequently, System Suitability parameters can be plotted on control charts for data trending. Data trending allows users to monitor method performance and take corrective action before out-

of-specification products are produced.

The functionality of interactive System Suitability and control charts are highlighted through this case study below:

Six System Suitability standards are analyzed at the start of the sample run and, to ensure that the system is performing well, the analyte's Retention Time must fall within $\pm 3\%$ of the target Retention Time.

Analyte	Target retention time (min)
Acesulfame K	0.650
Benzoic acid	1.004
Sorbic acid	1.450
Caffeine	1.700
Aspartame	2.000

Table 1. Table of target Retention Time of the various analytes.

Results and Discussion

In the Processing Method

First, System Suitability criteria are set up in your Empower Processing Method through the *Limits Tab*. Click on the target component and select the parameters that you wish to monitor in the Suitability Limits table. For this example, the target Retention Time and an error % of 3% for all components has been set.

		▼ Flag Val	es Outside L	mits																
								Suital	bility Compo	nents										
Ē		Na	me				Calculate Suit Results							Flag Outside Limits						
1	Acesulfame K						ᅜ									V				
2	Benzoic Acid														v					
3	Sorbic Acid						▽						₩.							
1	Caffeine								┍				_				V			
5	Aspartame								⊽								⊽			
=													_							
									itability Lin	_										
E	Field Name	Target	Error %	Lower Error Limit (L		CL) Upper Error Limit ((UCL)	Warning 9	Lower	Wa	rning Limit	Upp	Upper Warning Limit		Ignore Blank Values		Check Limits		
1	Retention Time 0.650		3.00	0		331 0.		0.670										During Qua	intitation	
													_		_					
ana a	egration) Something/Other (Comprised to		a) on value [Deb	(ensurance ju	samed Carolys Timed Car	ngs turatory turns	Stone and Cod (# (# links)			ongonaels [inquels] Ps Outsik Links	gi Ratios S	95 to Ratios Calcult Los	ourla Purity)	Named Groups Timed Se	repo Sulpolity Limit	a bicon and Date]		
Are	IF IngVisionOutsicLes Same soufame K			Suitability Compon alculate Suit Fless IP	wents	turating turners	Filip Outside Limi	its	1 Acc	IF II,		Deside Links	api Refer 3	Date	bility Compo late Suit Res	menta	Trapo Delacido Cent	Flag Outside Lin	ida	
Are Del	P ragviserovisk Lex Stans evelane K stock Add			Suitability Compon alcolate Suit Fersi IP IP IP	wents	hogo] turnating (sawas	Flag Cutside Limi	iits	1 Aug	(Figure K occ Acid (Acid	ig/lden	Deside Links	an Enter 3	Date	bility Compo late Stat Per IV	menta	trees (Inducity Limit	Flag Outside Lin	als .	
Are See Call	P hag Value Grade Les Same evalume K spec Add			Suitability Compon alcolate Suit Fiero D D	wents	ogo] turatny (siere	Flag Cutside Limi	iki.	1 Alei 2 des	(Fine K c)C Acid (SAVE)	ig/lden	Deside Links	gi Estos 3	Date	bility Compo late Suit Res	menta	Costal Suitability (Lievit	Flag Outside Lin	alse .	
Ass Soil Call Ass	IF may visue Outob Line Steme evultame K apoc Auli force partame		ě	Suitability Comoon alculate Suit Ress IP IP IP IP Suitability Limit	overts vits		Fing Outside Limit D D D D D D D	lyfn	1 Airi 2 desi 3 see 4 Cult 6 Asp	SF Es	Bank	Cheide (John		Solution Confection Co	bility Compo late Duk Per IV IV IV	nords sulfs		Flag Outside Lin	Seatt on the	
Are Set Set Call	IF may visue Outob Line Steme evultame K apoc Auli force partame		Upper Bros Limit (L	Suitability Comoon alculate Suit Ress IP IP IP IP Suitability Limit	ounts uits		Fing Outside Limit D D D D D D D	lyfn	1 April 2 Section 3 Section 4 Cultural 4 April 2 Section 5 April 2 Section 5 April 2 Section 6 April 2	SF The	Bank	Cheide (John		Data Calcul	bility Compo late Duk Per IV IV IV	nords sulfs		Flag Outside Lin	Check Limit	
Are See Call Asp	W majorates Carlois Les Steme	over Environ 4.CL)	Upper Bros Limit (L	Suitability Comoon alculate Suit Rens D P P P P Suitability Limit CL) Warning N	overts vits		Flag Cutoide Limi	Check L	1 April 2 Section 3 Section 4 Cultural 4 April 2 Section 5 April 2 Section 5 April 2 Section 6 April 2	SF The	Rane	Cheide Links	int (LCL)	Soluti Calcul Soluti Upper Einer-Limit (UCL)	bility Compo late Duk Per IV IV IV	nords sulfs		Flag Outside Lin S S S S S S S S S S S S S	Check Limit	
Ace Sor Caff Aug	W majorates Carlois Les Steme	ower Error Limit 4.CL) 0.074	Upper Error Limit (Li	Suitability Componing Comp	onts Is Liver Warning Leve	Upoe Staning Link	Fing Cutnisfe Limit P P P P P P Sprint Blank Values	Check L	3	Since No. And And No. And	Harris E 410	Constitution Toron No. Lawrer Error Li	1467	Soluti Calcul Soluti Upper Einer-Limit (UCL)	bility Compo late Suit Res U U U U U Attability Linn Warning N	needs suits Ro Lover Warning Limit	Upper Warring Link	Flag Outside Lin Flag Flag Flag Flag Flag Flag Flag Flag	Check Link	
Ace Set Set Aug	Figure Order Line State Find Name State	ower Error Limit 4.CL) 0.074	Upper Error Limit (L. 1. MOI ton Fumos) Collec	butability Component Compo	is Univer Marring Unit Liver Marring Unit Liver Marring Unit Liver Marring Unit Liver Drawn Timed On Arrests	Upoe Staning Link	Flag Cutoide Limi	Check Li During Quart	3	Since No. And And No. And	Harris E 410	Check Link Ener No. Lever Ener Li 3.40 onconent Innovin (Per	1467	Suital Colorul Colorul Sygner Error Limit (UCS) F 430 His on Platos Celtariticos	bility Composite State Res	nends Alls Lower Warning Lines Estated Grossel (trines Ger	Upper Warring Link	Flag Outside Lin P P P P P P P P P P P P P	Check Limit During Quantital	
Ace Ace Ace	Freywork order to Since Service X	ower Error Limit 4.CL) 0.074	Upper Error Limit (L. 1. MOI ton Fumos) Collec	butakity Compon alcolate Sul Fero P P P Sulseiny Limit COLD Westing % Detailed but Sulseiny Limit Economic but Jim Economic	is Univer Marring Unit Liver Marring Unit Liver Marring Unit Liver Marring Unit Liver Drawn Timed On Arrests	Upoe Staning Link	Flag Cubrick Limit So So So So So So So Flag Outside Limit Flag Outside Limit So So Flag Outside Limit So So So So So So So So So S	Check Li During Quart	G	P In- State K SC Add Se And Se	Name Name Name (Co. Co. Co. Co. Co. Co. Co. Co. Co. Co.	Check Link Ener No. Lever Ener Li 3.40 onconent Innovin (Per	1467	Suital Colorul Colorul Sygner Error Limit (UCS) F 430 His on Platos Celtariticos	bility Composite Sail Res	nends Alls Lower Warning Lines Estated Grossel (trines Ger	Upper Warring Link	Flag Outside Lin Flag Outside Lin Flag Outside Where Flag Outside Lin Flag Outside Lin Flag Outside Lin Flag Outside Lin	Check Limit During Quantitati	
Ace Ber Ren Ace Ber	Financian Line Since	ower Error Limit 4.CL) 0.074	Upper Error Limit (L. 1. MOI ton Fumos) Collec	butability Componental Compone	is Univer Marring Unit Liver Marring Unit Liver Marring Unit Liver Marring Unit Liver Drawn Timed On Arrests	Upoe Staning Link	Flag Cunside Limi	Check Li During Quart	1 April 1 Apri	Financian No. Add Action No. Add Act	Name Name Name (Co. Co. Co. Co. Co. Co. Co. Co. Co. Co.	Check Link Ener No. Lever Ener Li 3.40 onconent Innovin (Per	1467	Suital Colorul Colorul Sygner Error Limit (UCS) F 430 His on Platos Celtariticos	bility Composite Stat Res	nends Alls Lower Warning Lines Estated Grossel (trines Ger	Upper Warring Link	Flag Outside Lin	Check Limb	
Acre Call Aug Ren Ber Son Call	IF ingressional ten Status Sta	ower Error Limit 4.CL) 0.074	Upper Error Limit (L. 1. MOI ton Fumos) Collec	Substitity Component of the Component of	is Univer Marring Unit Liver Marring Unit Liver Marring Unit Liver Marring Unit Liver Drawn Timed On Arrests	Upoe Staning Link	Flag Cutofe Line D D D D D D D D D D D D D	Check Li During Quart		Final Streetman Tries Included Streetman Tries Included Streetman Inc	Name Name Name (Co. Co. Co. Co. Co. Co. Co. Co. Co. Co.	Check Link Ener No. Lever Ener Li 3.40 onconent Innovin (Per	1467	Suital Colorul Colorul Sygner Error Limit (UCS) F 430 His on Platos Celtariticos	bulley Company Assaults State Rail	nends Alls Lower Warning Lines Estated Grossel (trines Ger	Upper Warring Link	Fing Outside Lin Fing Outside	Check Limb	
Acre Call Aug Ren Ber Son Call	Firey hard conductor State S	ower Error Limit 4.CL) 0.074	Upper Error Limit (L. 1. MOI ton Fumos) Collec	Subshilly Component of the Subshill Componen	swets substitute of the state o	Upoe Staning Link	Flag Cotable Limit SP SP SP SP SP SP SP SP SP S	Check Li During Quart		Final Streetman Tries Included Streetman Tries Included Streetman Inc	Name Name Name (Co. Co. Co. Co. Co. Co. Co. Co. Co. Co.	Check Link Ener No. Lever Ener Li 3.40 onconent Innovin (Per	1467	Bullet States September 1 States	body Company to the Company of the C	one dip Allo Lover Wanning Lines Texas di Crassilli Times Ger Texas di Crassilli Times Ger	Upper Warring Link	Plag Outside Lin P P P P P P P P P P P P P	Check Limb	
Acc Series Serie	IF ingrised circle for States	over Entr Line & CLU 6.074	Upper Error Limit () 1. ##Ditan Fathers Default	Substitive Control of the Control of	swets substitute of the state o	Upper Strating Lines	Fing Outside Limit D D D D D D D D D D D D D	Check L		SF IN. SEARCH NO. And	Name Co	Drow No. Leaver Drow To. 3 80 200 Construction of the Cons	1467 1467 W.Kalon, 6	Bullet States September 1 States	bolisy Company to the Park Territory of the	needs to be a seed of the seed	Cipper Warring Line	Fing Outside Lin Page	Check Limb During Quantitate to	

Figure 1. Click on each of the target component and select the parameters you wish to monitor in the Suitability Limits table.

In the Method Set

The Processing Method is added into the Method Set to allow Empower to process and evaluate your System Suitability criteria during the run.

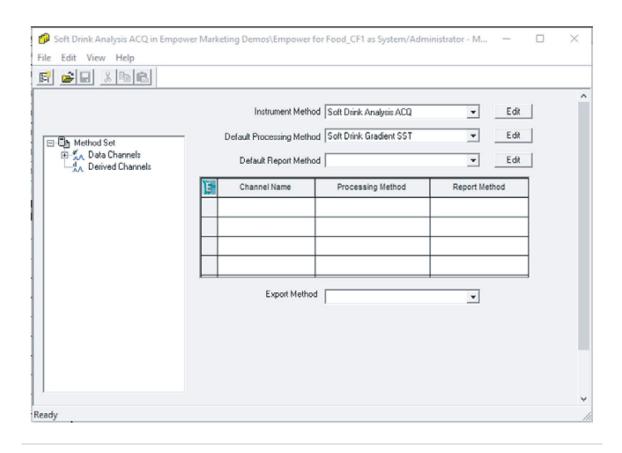


Figure 2. Adding the Processing Method to the Method Set to allow for automated processing.

In the Run Samples Window

After your Sample Set is set up, the Run Mode and Suitability Mode are configured to enable interactive System Suitability. In the *Run Mode*, choose "Run Only", "Run and Process", or "Run and Report" for online data processing. "Run and Process" and "Run and Report" will result in the generation of results. Here, select "Run and Process".

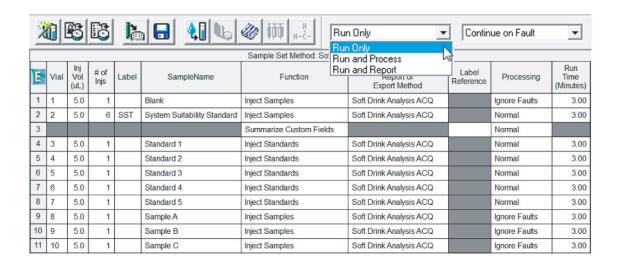


Figure 3. Select the Run Mode for online data processing.

The *Suitability Mode* allows you to configure Empower to take actions to continue the run, stop the run or reinject samples, in the event of System Suitability faults. Faults happen when the injection fails to meet the limits set. For this example, we will choose "Stop on Fault".

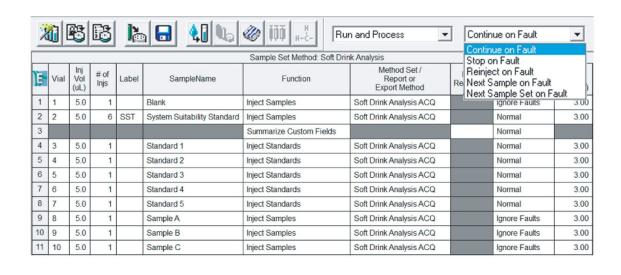


Figure 4. Select the Suitability Mode to configure Empower to take specific actions in the event of a System Suitability failure.

Next, the System Suitability standards are analyzed. Empower continues your sample run if System Suitability limits pass or aborts the run if System Suitability limits fail.

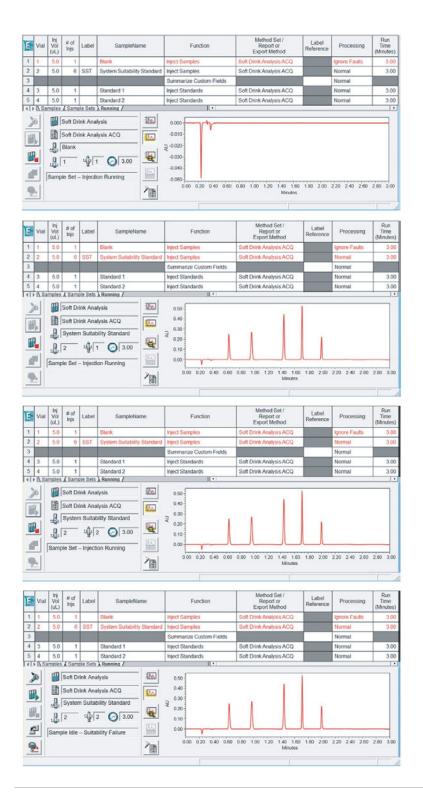


Figure 5. Empower continues the sample run if System Suitability limits pass or aborts the run if

System Suitability limits fail. This allows for an unattended, hands-free operation.

Upon detecting a System Suitability fault in the second injection of the System Suitability standard, Empower aborts the run and indicates a suitability failure. You can review possible faults in the Review window.

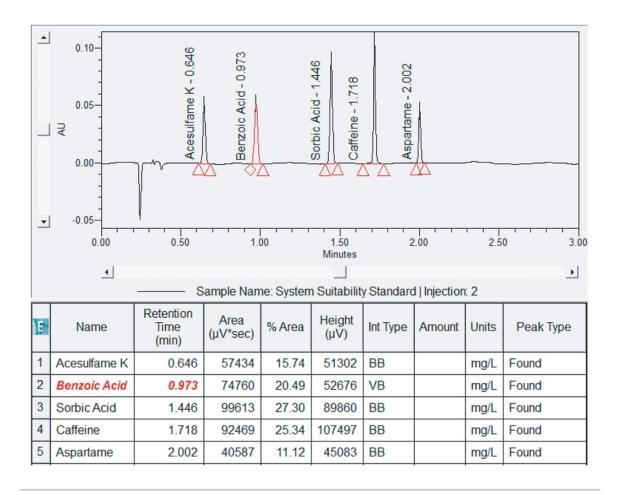


Figure 6. Review window displaying System Suitability failure for Benzoic Acid.

System Suitability faults are automatically highlighted in red, bold, and italics for you. Here, it is observed that Benzoic Acid's Retention Time of 0.973 min falls outside the $\pm 3\%$ error range of 0.974 to 1.034 min.

Data Trending in Publisher

Benzoic acid's Retention Time can be trended across multiple injections to determine if there is a drift towards an out-ofspecification result. To observe the data trending across multiple results, a Summary Report is required. This can be set up through Method Properties. Access Method Properties through the Edit Menu and select Method Properties. Here, we choose a Summary by All report.

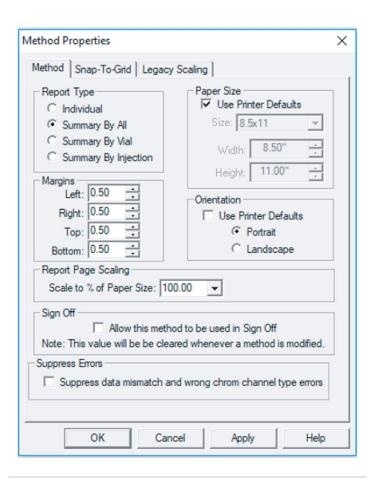


Figure 7. Method Properties in Report Publisher.

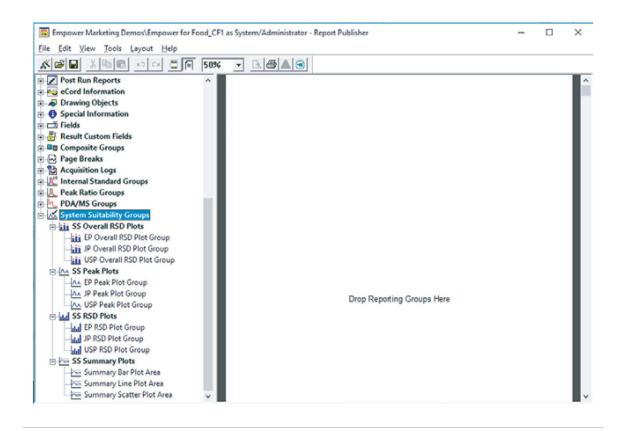


Figure 8. Report Publisher allows users to plot control charts via System Suitability groups.

On the right is the report method layout, while the list of report groups can be found on the left. System Suitability groups allow you to plot control charts. To observe the data trending for Retention Time, the SS Summary Plots are used. There are three display options for your Summary Plot, namely, Bar Plot, Line Plot, and Scatter Plot.

By default, Area will be trended for your Summary Plot. This can be changed in the Summary Plot Properties. Right click on the plot to access the Summary Plot Properties. There is an extensive selection of parameters – Empower built-in fields and custom fields inclusive – to choose from. We will select Retention Time to assess the trending of benzoic acid's Retention Time over six System Suitability standard injections.

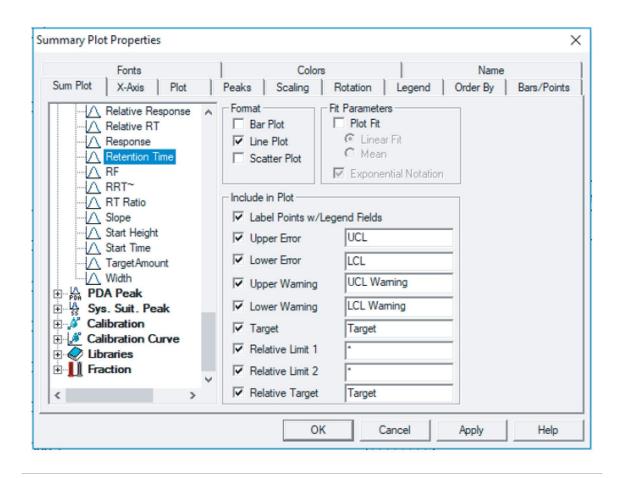


Figure 9. Summary Plot Properties allow users to set the parameter that they would like to trend.

The Summary Line Plot of benzoic acid's Retention Time over six injections revealed that the injections were mostly trending near the lower error limit. Investigations and preventive corrective actions would be necessary to ensure that the method continues to maintain its optimum performance.

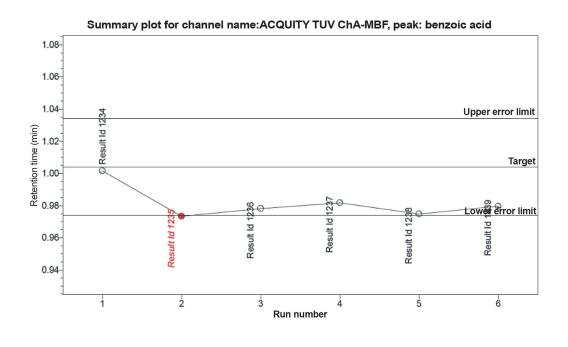


Figure 10. Summary line plot of benzoic acid's Retention Time trending over six injections.

Conclusion

Empower CDS allows for an assessment of your System Suitability standards in an automated manner.

Laboratory productivity is increased as you do not have to manually assess System Suitability criteria. Upon failing the requirements, sample runs can be configured to continue, abort, or reinject the standards, allowing for a true hands-off system operation. Control charts provide you graphical representations of the result performance trends over time, allowing you to easily review and identify out-oftrend results.

Empower CDS's interactive System Suitability and control charts work in tandem to help assure that your laboratory continuously generates valid results while maintaining laboratory productivity.

Featured Products

Empower Chromatography Data System (CDS) https://www.waters.com/nextgen/global/products/informatics-and-software/chromatography-software/empower-software-solutions/empower-cds.html

720007010, October 2020



© 2024 Waters Corporation. All Rights Reserved.

Termos de Uso Política de Privacidade Marcas comerciais Carreiras Avisos jurídicos e de privacidade Cookies Preferências de cookies